


Showpiece Pro Stand - Quick Setup Guide

Hardware Parts List

Item Number	Part Number	Item Description	Total Item Quantity
1	752392301	Lower Tube	2
2	752392309	Center Bracket	1
3	752392302	Lower C Tube	1
4	752392303	Lower Arc Tube	2
5	752392304L/R	Lower Plate (LH/RH)	2
6	752392307L/R	Lower Joining Bracket (LH/RH)	2
7	752392321	Upper Tube	2
8	NA	VESA Mounting Kit	1
8a	752392305	-VESA Mounting Bracket	1
8b	752392406	-LCD Mounting Bracket	2
9	780000325	-Screw, 8-32x1-1/4 (LCD Bracket)	2
10	775000120	Carriage Bolt 1/4-20 x 2	8
11	775000121	Carriage Bolt 1/4-20 x 2 ½	6
12	775000122	Carriage Bolt 1/4-20 x 4 ½	6
13	775000320	Carriage Bolt 1/4-20 x 30 mm	2
14	NA	Carriage Nut	20
15	NA	Washer	20
16	795000211	2" Plug, Square Ribbed (Installed)	2
17	795000261	Leveling Feet (Installed)	2



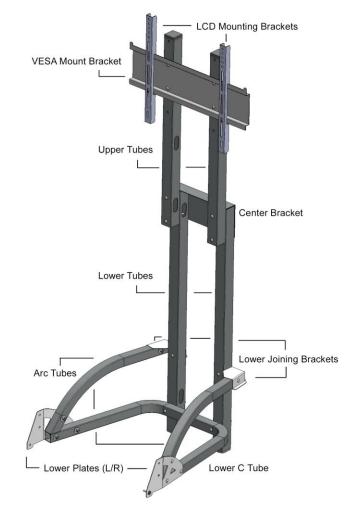

Tools: You will need a 7/16" deep socket and nut driver, 4mm hex Allen key and a Phillips screwdriver.



For more detailed assembly instructions, follow the QR Code to the Pro Stand Install Guide.



Showpiece Pro Stand - Quick Setup Guide

Assembly Instructions

- Use four 4½" Carriage Bolts, Washers and Nuts to attach two Upper Tubes through two Lower Tubes and one Center Bracket.
 Oval mouse holes for cables face inward on Upper and Lower Tubes.
- Use two 4½" Carriage Bolts, Washers and Nuts to attach Lower C Tube to Lower Tubes. (Make sure the oval cutout on the Lower C Tube is on the right side when facing the open C.)
- Use one 2" Carriage Bolt to attach Lower Joining Bracket (L/R) to each Arc Tube. Then use one 2 ½" Carriage Bolt to attach each Joining Bracket to the Lower Tubes so they form a right angle. See Inset 1.
- Connect Arc Tubes to Lower C Tube with a Lower Plate (L/R) on each side. See Inset 2.
 - Use three 2" Carriage Bolts, Washers and Nuts (careful to have Washer and Nuts inside the frame) to attach a Lower Plate to the Arc Tube and Lower C Tube on each side.
- Place stand near electrical outlet. Move stand upright so Leveling
 Mounts are on the floor. Adjust Mounts as necessary. Move cabinet into
 place in the middle of Lower C Tube. Use a 4 mm hex Allen key to
 remove a screw from each side of the cabinet.
- Secure two 1/4-20 x 30 mm bolts through Lower Plate on each side. See Inset 2.
- Reattach the removed hex screws in the highest position on the Lower Plates to each side of the cabinet.

VESA Mounting Kit Assembly

- Use four 2 ½" Carriage Bolts, Washers and Nuts to attach VESA Mount Bracket horizontally across front of Upper Tubes. There are four pre-cut holes at the top of the tubes—use the two middle holes on each tube.
- Use two Screws, 8-32x1-1/4 (LCD Bracket) to attach the LCD Mounting Brackets
 - PGA Horizontal

- Slide two LCD Mounting Brackets attached to Monitor onto VESA Mounting Bracket and align with the Upper Tubes.
- Use a Phillips screwdriver to tighten in place with one Machine Screw on each side.
- Drop cables from Monitor through mouse holes.

